

PROBLEM SYMPTOMS TABLE

RADIO RECEIVER ASSY

Symptom	Suspected Area	See page
Pressing power switch does not start system.	1. Power source circuit (radio receiver assy) 2. Power source circuit (radio receiver display)* 3. Replace radio receiver assy	05-1025 05-1028 Pub. No. RM864E, 67-2
Turning on light switch does not light up night time illumination of radio receiver or display.	1. Illumination circuit (radio receiver assy) 2. Illumination circuit (radio receiver display)* 3. Replace radio receiver assy	05-1031 05-1037 Pub. No. RM864E, 67-2
All switches do not respond.	1. Steering pad switch circuit 2. Replace radio receiver assy	05-1043 Pub. No. RM864E, 67-2
No sound can be heard.	1. Power source circuit (radio receiver assy) 2. Speaker circuit 3. Replace radio receiver assy	05-1025 05-1047 Pub. No. RM864E, 67-2
Sound quality is bad in all modes. (volume is too low)	1. Power source circuit (radio receiver assy) 2. Speaker circuit 3. Sound quality is bad in all modes (volume is too low)	05-1025 05-1047 05-1056
Noise occurs.	-	05-1069
Radio broadcast cannot be received. (bad reception)	-	05-1057
CD cannot be inserted or is ejected right after insertion.	1. Power source circuit (radio receiver assy) 2. CD cannot be inserted or is ejected right after insertion	05-1025 05-1059
CD cannot be ejected.	1. Power source circuit (radio receiver assy) 2. CD cannot be ejected	05-1025 05-1061
Sound quality is bad only when playing CD. (volume is too low)	-	05-1062
CD sound skips.	-	05-1063
Cassette tape cannot be inserted or played.	1. Power source circuit (radio receiver assy) 2. Cassette tape cannot be inserted or played	05-1025 05-1065
Cassette tape cannot be ejected.	1. Power source circuit (radio receiver assy) 2. Cassette tape cannot be ejected	05-1025 05-1066
Sound quality is bad only when playing tape.	-	05-1067
Tape is tangled due to incorrect tape speed or auto-reverse mal-function.	-	05-1068
Fuel efficiency is not displayed.	-	05-1052
Ambient temperature is not displayed.	-	05-1054

*1: Europe model

STEERING PAD SWITCH

Symptom	Suspected Area	See page
A audio system cannot be operated with steering pad switch.	1. Steering pad switch circuit 2. Replace radio receiver assy	05-1043 Pub. No. RM864E, 67-2