


ENTIRE COMBINATION METER DOES NOT OPERATE

WIRING DIAGRAM

LHD Models:

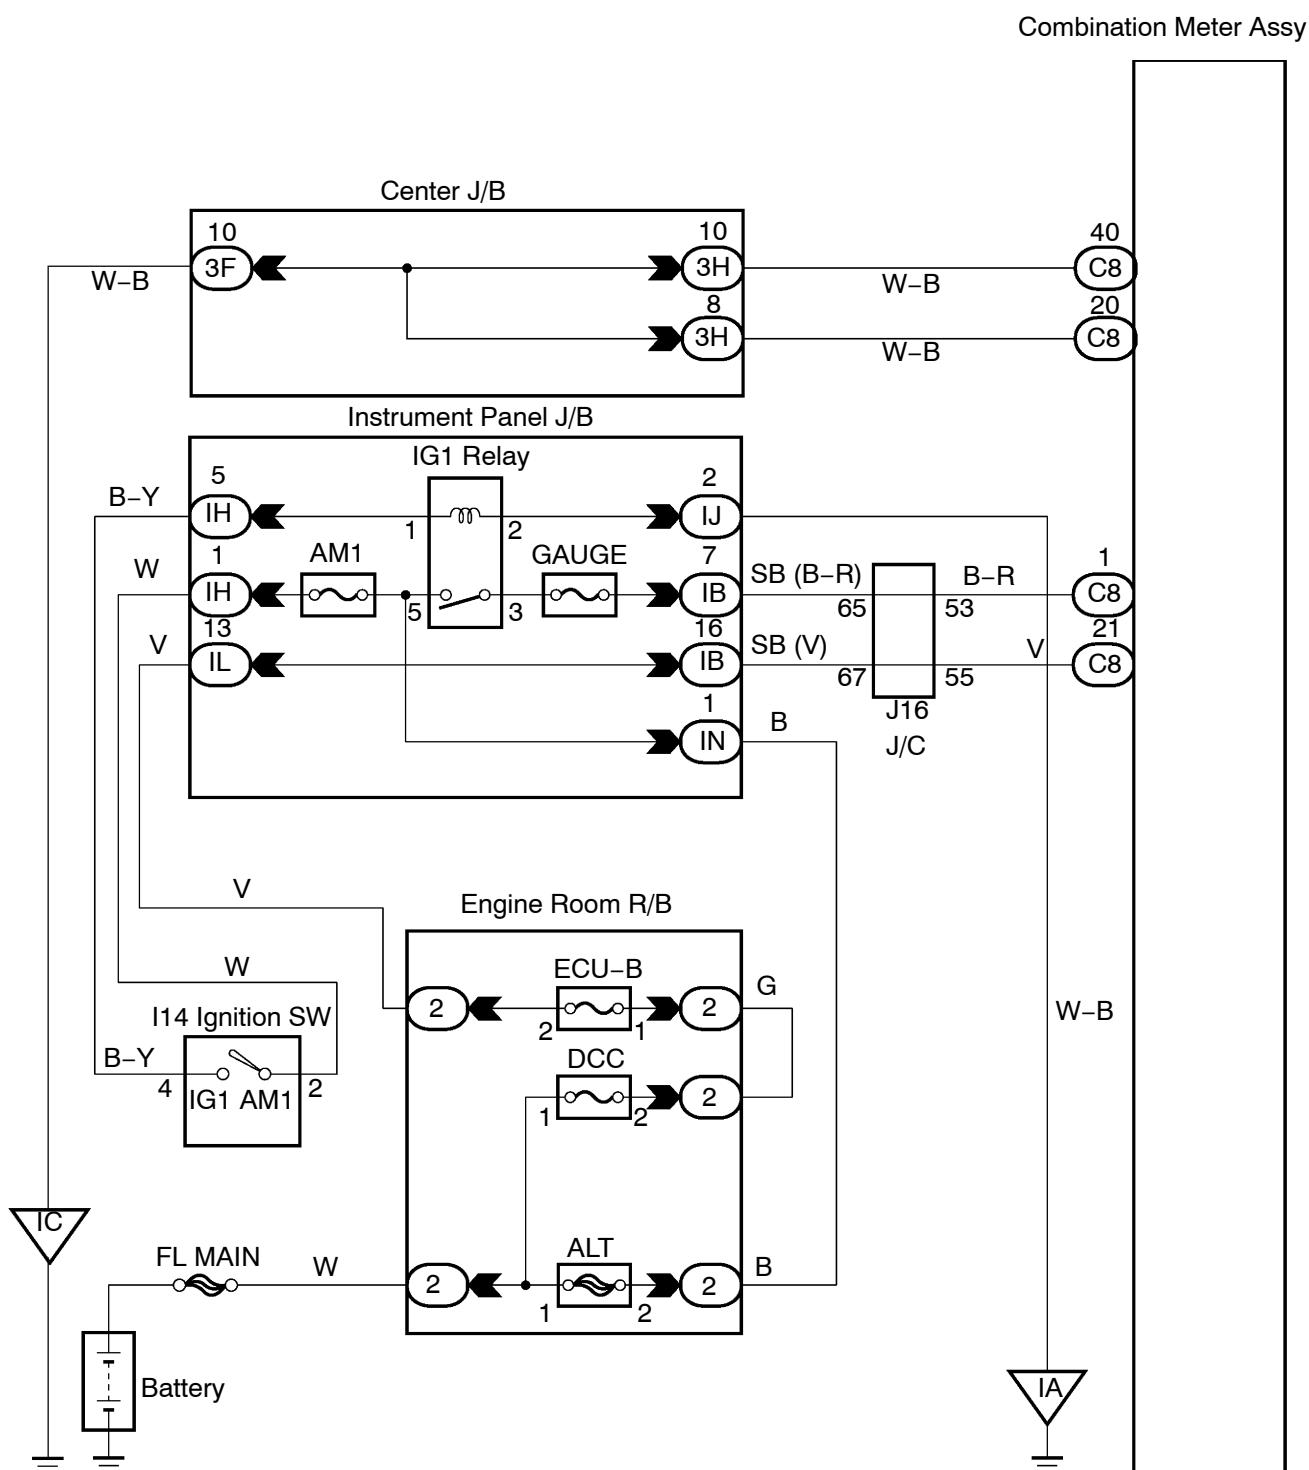


C

I41872

RHD Models:

Combination Meter Assy

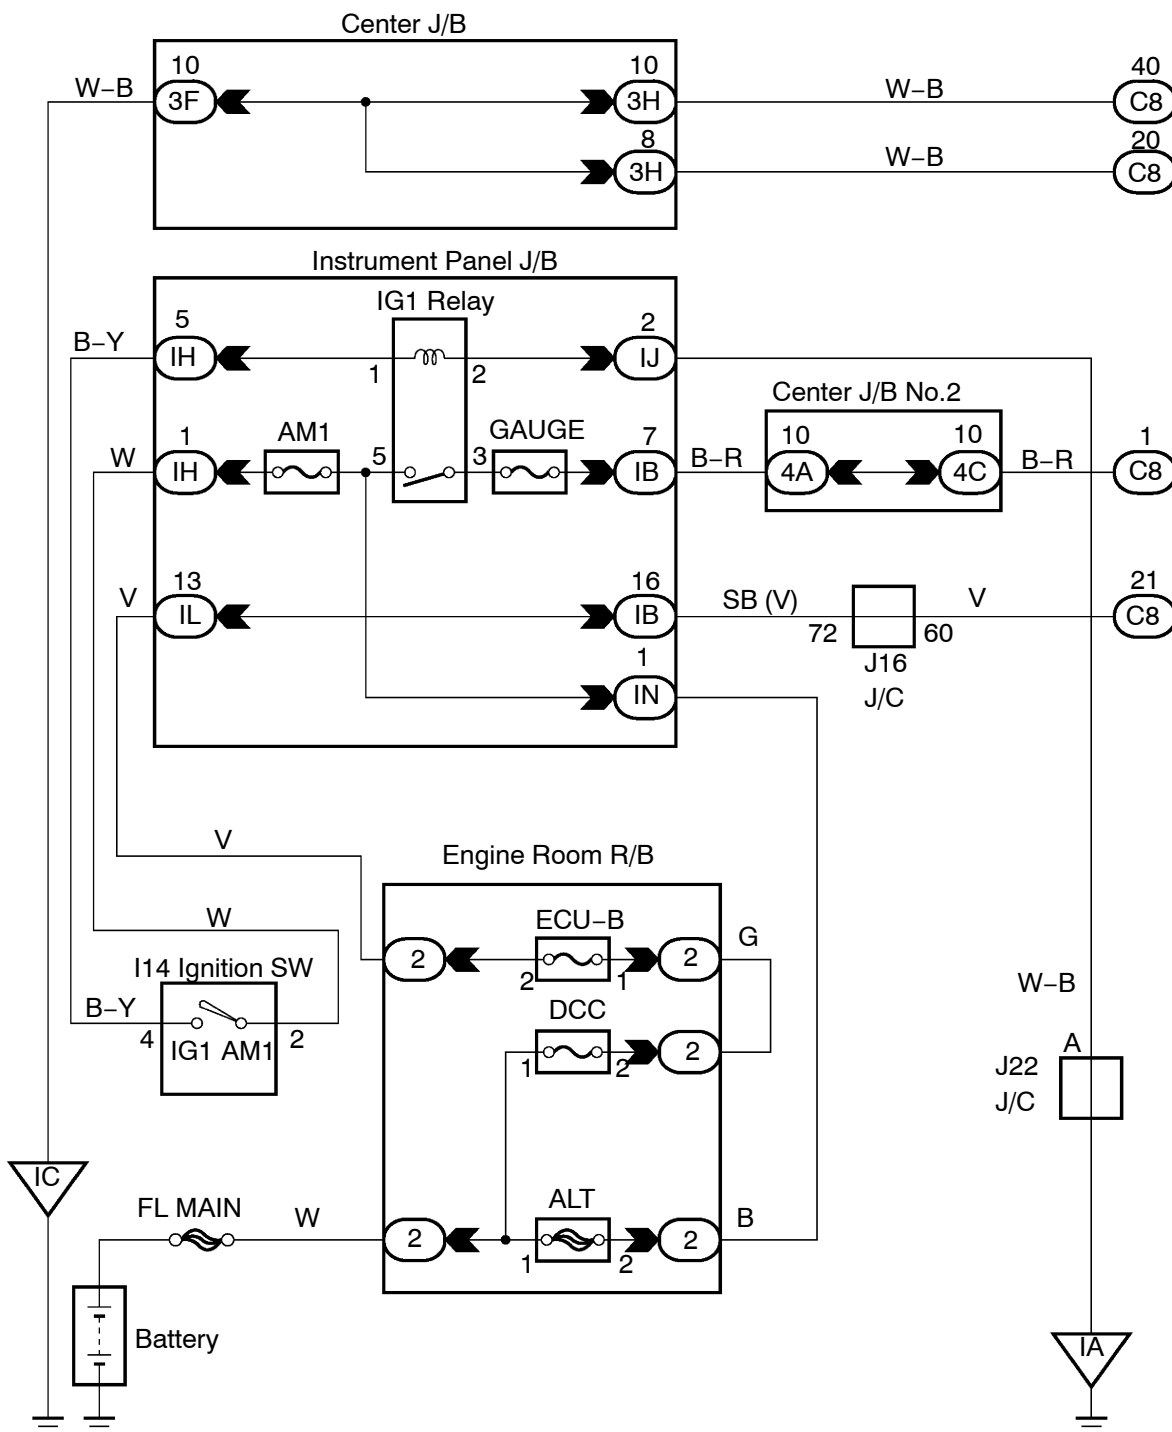


C

I41364

INSPECTION PROCEDURE

1 INSPECT COMBINATION METER ASSY

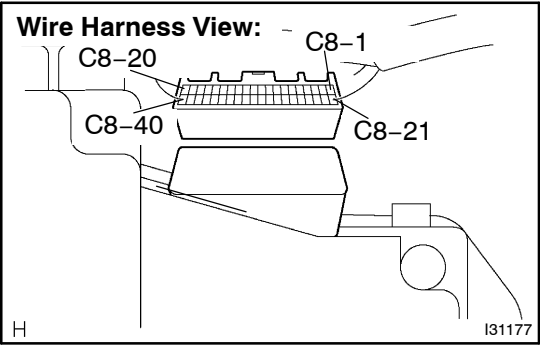

(a) Measure the resistance according to the value(s) in the table below.

Standard:

Terminal No	Condition	Specified condition
C8-20 - Body ground	Always	Below 1 Ω
C8-40 - Body ground	Always	Below 1 Ω

(b) Measure the voltage according to the value(s) in the table below.

Standard:

Terminal No	Condition	Specified condition
C8-21 - Body ground	Always	10 to 14 V
C8-1 - Body ground	Ignition switch ACC or ON	10 to 14 V

NG

REPAIR OR REPLACE HARNESS OR CONNECTOR

OK

REPLACE COMBINATION METER ASSY