



Technical Service BULLETIN

July 30, 1999

Title:

COWL TOP VENTILATOR LOUVER SUB-ASSEMBLY


Models:

'96 - '98 RAV4

AC003-99

HEATING & AIR CONDITIONING

Introduction An improved Cowl Top Ventilator Louver Sub-Assembly is available as a field fix to help prevent snow from entering the Cowl Vent.

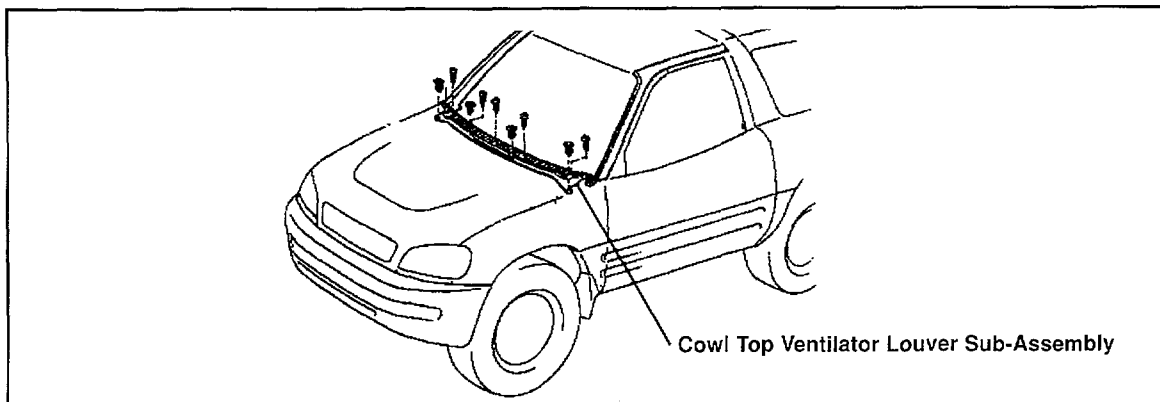

Applicable Vehicles

- 1996 - 1998 RAV4

Parts Information

CURRENT PART NUMBER	FIELD FIX PART NUMBER	PART NAME
* See NOTE Below	55708-42090	Louver Sub-Assembly, Cowl Top Ventilator
87130-16160	Same	Blower Assembly

* NOTE: P/N 55708-42040 applicable for "Non-Cold Area Spec"
P/N 55708-42050 applicable for "Cold Area Spec"

Repair Procedure

If during the process of diagnosing heater blower problems, the presence of water is noted in the Blower Assembly, replace both the Cowl Top Ventilator Louver Sub-Assembly and the Blower Assembly.

Warranty Information

OPCODE	DESCRIPTION	TIME	OPN	T1	T2
AC9002	R & R Cowl Top Ventilator Louver	0.5	* See NOTE Above	66	99
AC9004	R & R Blower Assembly	3.5	87130-16160	95	83

Applicable Warranty*:

This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.

NOTE:

Flat rate time for Op Code AC9004 includes removal and reinstallation of cooling unit assembly.



Toyota Supports ASE Certification

Index # 051981