



**Introduction** The Tire Pressure Warning System (TPWS) monitors the difference in tire pressure in all four or five tires (if the vehicle is equipped with a full-size spare tire) through radio wave signals from a tire pressure valve/sensor mounted in each wheel.

This bulletin provides an overview and diagnostic information for the direct-type TPWS.

**Applicable  
Vehicles**

- **2004 – 2007** model year **4Runner** vehicles.
- **2005 – 2006** model year **Tundra** vehicles.
- **2005 – 2007** model year **Sequoia** vehicles.
- **2006 – 2007** model year **Land Cruiser, Prius, RAV4, and Tacoma** vehicles.
- **2007** model year **Avalon, Camry, Solara, and Scion tC** vehicles.

**Required  
SSTs**

ITEM NO.	SPECIAL SERVICE TOOLS (SSTs)	PART NUMBER	QTY	DRW**
1	<b>Toyota Diagnostic Tester Kit*</b> NOTE: <ul style="list-style-type: none"> <li>• All components from this kit/set are required.</li> <li>• 12 Megabyte Diagnostic Tester Program Card (P/N 01002593–005) with version 13.4a Software (or later) is required.</li> </ul> 	TOY220036	1	9
2	<b>CAN Interface Module Kit*</b> NOTE: <ul style="list-style-type: none"> <li>• All components from this kit/set are required.</li> </ul> 	01002744	1	9

\* Essential SSTs.

\*\* Drawer number in SST Storage System.

**NOTE:**


**Additional Diagnostic Tester Kits, CAN Interface Modules, Program Cards, or other SSTs may be ordered by calling SPX/OTC at 1-800-933-8335.**

**Warranty  
Information**

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
N/A	Not Applicable to Warranty	—	—	—	—

**Summary of  
TPWS/  
Component  
Operation**

The following illustration is an example of the TPWS component locations on 2004 – 2007 model year 4Runner vehicles:

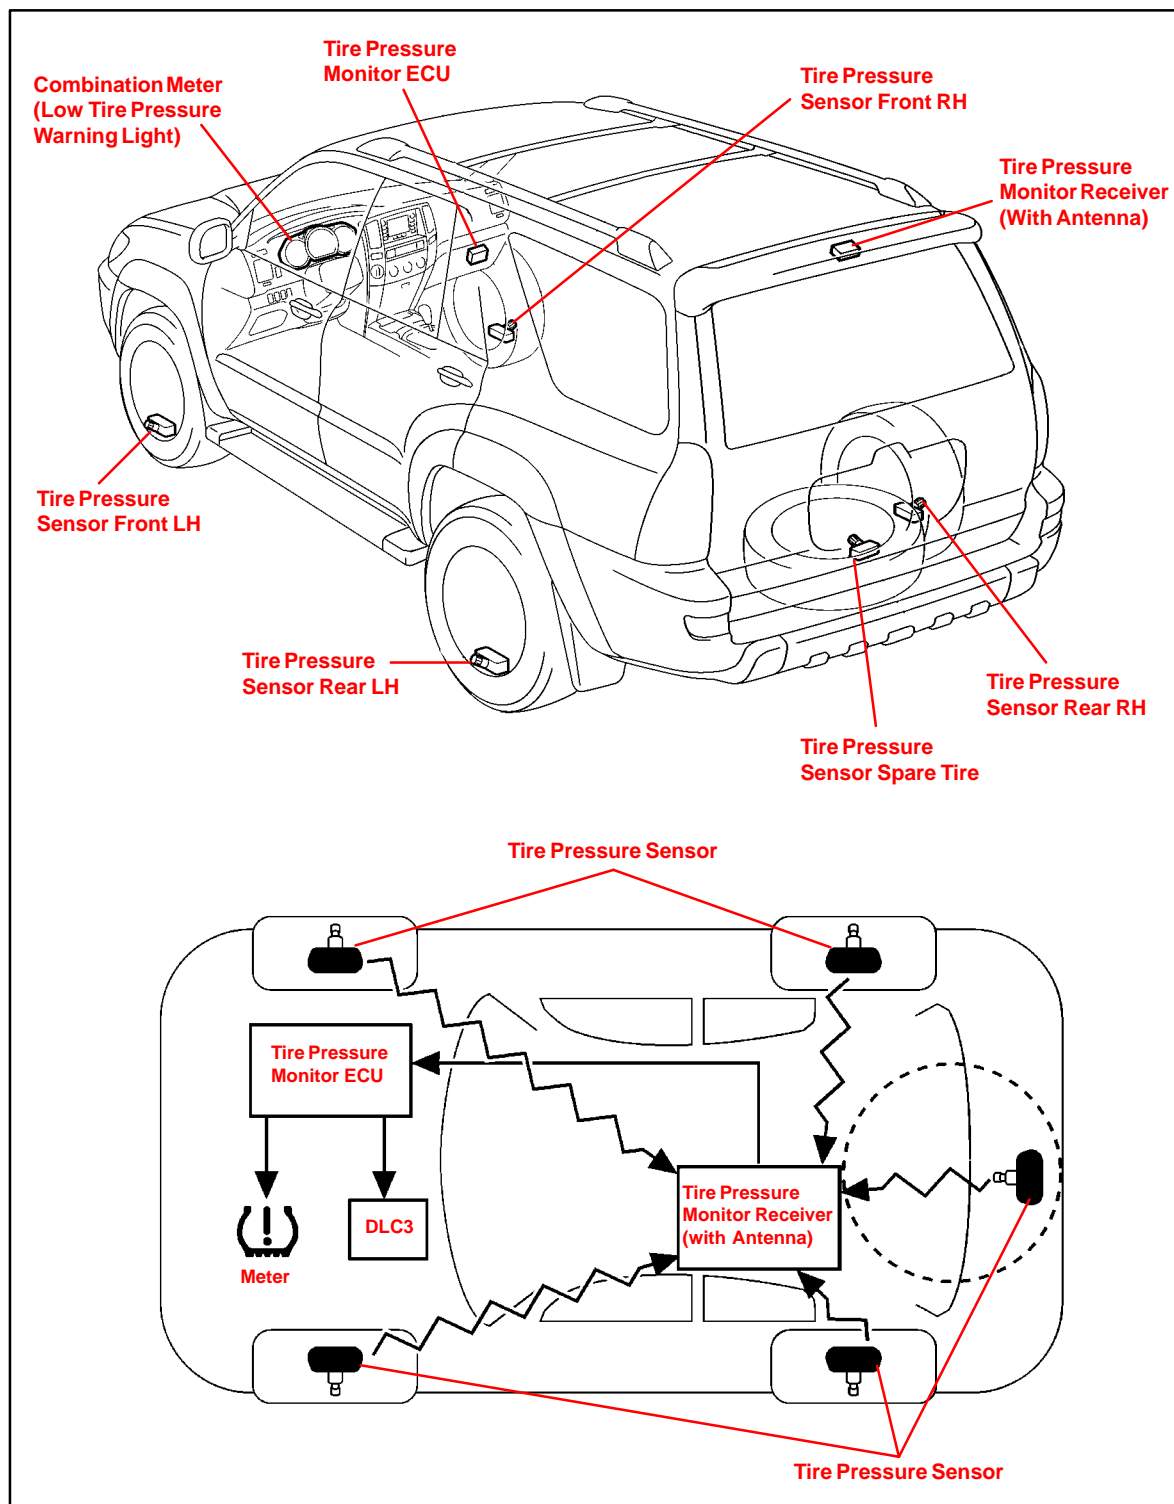

For exact location of each vehicle's TPWS components, refer to the Technical Information System (TIS), applicable model and model year Repair Manual: *Tire and Wheel* (refer to component or parts location). For additional information on the TPWS components and operation, refer to TIS, applicable model and model year New Car Features: *Chassis and Drivetrain*.


**Summary of  
TPWS/  
Component  
Operation**  
(Continued)

• **Tire Pressure Warning Valve/Sensor:**

Each wheel (including the spare tire on certain vehicles) has a tire pressure warning valve/sensor integrated into the air valve with a unique ID number that measures the tire pressure and tire temperature and then transmits the information to the antenna/receiver mounted inside the vehicle through a radio wave signal. The unique ID number must be manually entered into the ECU using the Diagnostic Tester whenever the tire pressure warning valve/sensor is replaced or after a tire and wheel are exchanged.

Vehicles equipped with a tire pressure warning valve/sensor inside the spare tire are listed in the following table:

MODEL	MODEL YEAR
4Runner	2004 – 2007
Avalon	2007
Camry (with Full-size Spare)	2007
Land Cruiser	2006 – 2007
RAV4	2006 – 2007
Sequoia	2005 – 2007
Solara (with Full-size Spare)	2007
Tacoma	2006 – 2007
Tundra	2005 – 2006

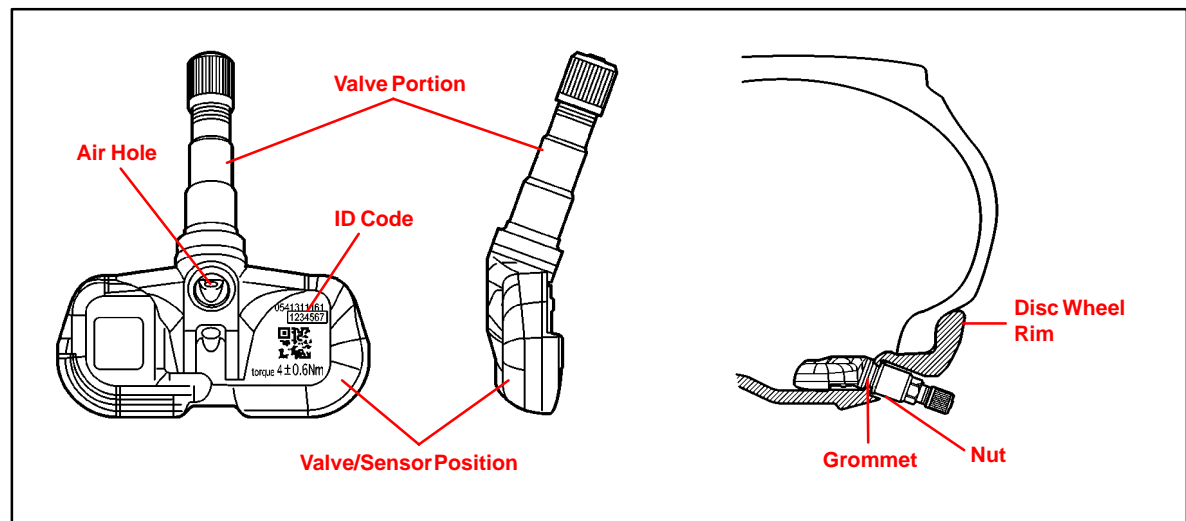

**NOTE:**

- All Japan-built vehicles require the tire pressure warning valve/sensors to be activated ("wake up") during Pre-Delivery Service (PDS).
- Each tire pressure warning valve/sensor is equipped with a lithium battery that has an average life span of 10 years.
- If a tire pressure warning valve/sensor is removed from the wheel, the grommet **MUST** be inspected and replaced if damaged.

**Summary of  
TPWS/  
Component  
Operation**  
(Continued)

- **Tire Pressure Warning System Antenna/Receiver:**

The antenna/receiver receives each tire pressure, tire temperature, and the unique tire pressure warning valve/sensor ID numbers through radio wave signals from the tire pressure warning valve/sensors and then transmits the information to the TPWS ECU.


- **Tire Pressure Warning System ECU:**

The ECU takes each tire pressure, tire temperature, and unique tire pressure warning valve/sensor ID information from the antenna/receiver and compares it to the specified value, which was registered during PDS. If the information received does NOT match the specified value registered in the ECU, it will transmit a signal to illuminate the Tire Pressure Warning System Indicator Light located on the combination meter. If the ECU is replaced, it is necessary to manually enter the tire pressure valve/sensor ID numbers using the Diagnostic Tester.

- **Tire Pressure Warning System Indicator Light:**

The Tire Pressure Warning System Indicator Light on the combination meter is illuminated or flashes continuously when the ECU senses that the tire pressure, tire temperature, and/or unique ID number does NOT match the specified value registered in the ECU.

Conditions for the Tire Pressure Warning System Indicator Light “ON” or “Flashing” are listed in the following table:

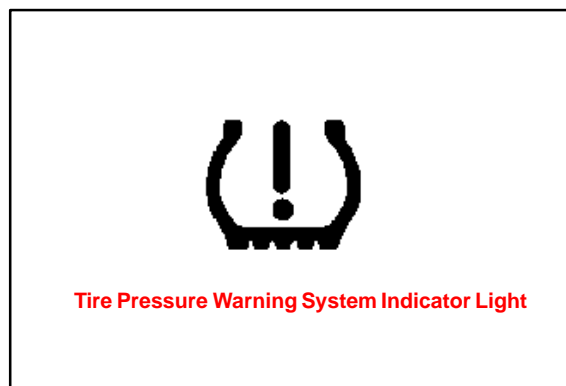

CONDITION	CAUSE	REPAIR
After turning the key ON, the TPWS Indicator Light illuminates for 3 seconds and then turns OFF	Normal — “System Check”	Normal Condition
TPWS Indicator Light is ON and will NOT turn OFF	Low tire pressure has been detected	Check that all tire pressures are set to the tire inflation pressure indicated on the vehicle loading specification label
After turning the key ON, the TPWS Indicator Light flashes for 1 minute and then turns ON steady or flashes continuously	System Failure	See the “System Concerns & Repair Methods” sections in this TSB

**Summary of  
TPWS/  
Component  
Operation**  
(Continued)


• **Initialization/“SET” Switch:**

When initializing the TPWS, the present tire pressure is set as the standard pressure (for example: 32 psi). The TPWS determines a decrease in air pressure by comparing the standard pressure to the tire inflation pressure received from the tire pressure warning valve/sensor.

Reasons for initializing the system include:

- When rotating tires that have different tire pressures in the front and rear.
- When changing or adjusting the tire pressure.
- When changing tire size or when tires are replaced.


The vehicles listed in the following table are equipped with an Initialization/“SET” switch:

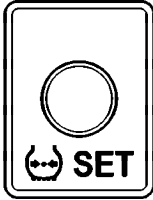MODEL	MODEL YEAR	ILLUSTRATION OF INITIALIZATION/“SET” SWITCH
Avalon	2007	
Camry	2007	
Land Cruiser	2006 – 2007	
Prius	2006 – 2007	
Scion tC	2007	
Solara	2007	
Sequoia	2005 – 2007	
Tacoma	2006 – 2007	
Tundra	2005 – 2006	

• **“MAIN/2nd” Switch (Land Cruiser vehicles ONLY):**


Land Cruiser is the ONLY Toyota vehicle with the “MAIN/2nd” switch. This allows the owner to have two different sets of tires and wheels, with two different sets of tire pressure warning valve/sensor ID numbers. For example, the second set would be used for snow tires. Therefore, register both the main and the second set of tire pressure warning valve/sensor ID numbers in the TPWS ECU using the Diagnostic Tester. Depending on what set of tire pressure warning valve/sensor ID numbers are being registered, the “MAIN/2nd” switch must be set in the correct position (i.e., “MAIN” for regular use tires and “2nd” for snow use tires).

- “MAIN/2nd” switch in the UP position — The TPWS ECU is programmed to read the main set of tire pressure warning valve/sensor ID numbers.
- “MAIN/2nd” switch in the DOWN position — The TPWS ECU is programmed to read the second set of tire pressure warning valve/sensor ID numbers.

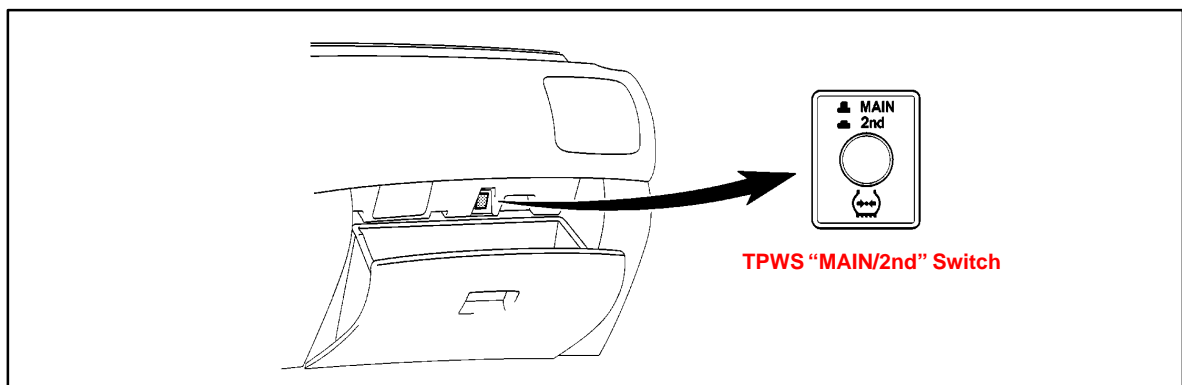

**Diagnostic  
Tester Setup**

When diagnosing the TPWS with the Diagnostic Tester, it must be set up to read the tire pressures in “psi – gauge” (psi – g). Follow the screens below from the Diagnostic Tester to convert the tire pressures to psi – g.

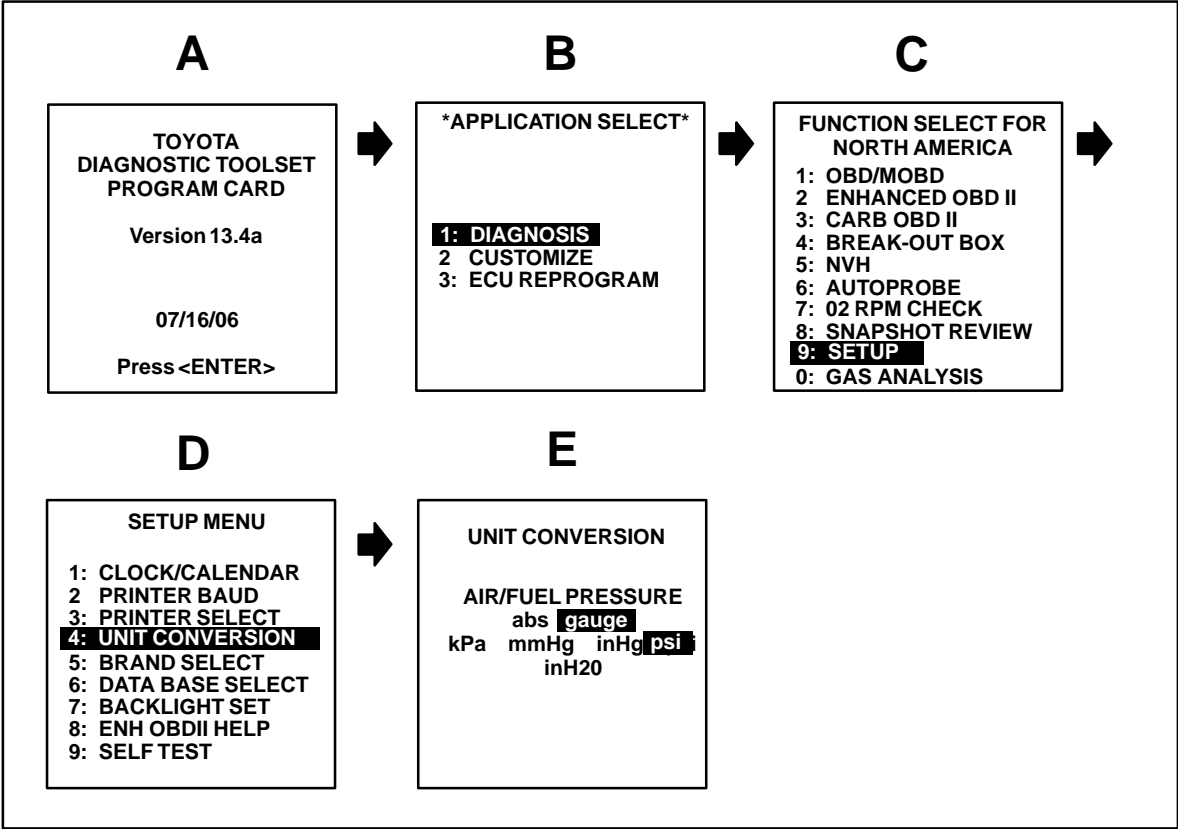

**System  
Concerns &  
Repair Methods**

COMMON SYMPTOM	CAUSE	REPAIR SUGGESTIONS
Cannot register the sensor ID numbers in the ECU using the Diagnostic Tester.	TPWS ECU is initialized.	Jump terminals TC & CG at the DLC3 connector for 30 seconds to reset the TPWS ECU. (Land Cruiser: jump terminals TC & E1 at the DLC1 connector.)
	Diagnostic Tester software is incorrect or incompatible.	Update software via TIS.
	“MAIN/2nd” switch is in the incorrect position (Land Cruiser ONLY).	Ensure correct switch position and make sure loose objects do not contact the switch.
Cannot complete Pre-Delivery Service (PDS) activation “wake up” procedure.  <b>NOTE:</b> Vehicles built in North America come with the transmitter sensors already activated (awake). Vehicles built in Japan require the transmitter sensors to be activated during PDS.  <b>DTCs:</b> C2111 C2112 C2113 C2114 C2115	Tire/wheel swapped prior to delivery to customer.	1) Record all sensor ID numbers from the Diagnostic Tester Data List. 2) Break down tires and compare the sensor ID numbers to what is recorded in the TPWS ECU. 3) If incorrect, register the correct sensor ID numbers using the Diagnostic Tester.
	Sensor ID numbers are not registered.	1) Break down tires and record all sensor ID numbers. 2) Register the sensor ID numbers in the TPWS ECU using the Diagnostic Tester.
	Transmitters are not activated (in sleep mode).	1) Tire pressure decrease is not fast enough. 2) Loosen the valve core when releasing air pressure from the tire to activate (“wake up”) the sensor (6 psi-g within 30 seconds).
One or more tire pressures display “-14 psi-g” & “-40°F” on the Diagnostic Tester Data List.  <b>DTCs:</b> C2121 C2122 C2123 C2124 C2125 C2177	1) Sensor ID numbers are not registered. 2) Tire/wheel swapped prior to delivery to customer.	1) Record all sensor ID numbers from the Diagnostic Tester Data List. 2) Break down tires and compare the sensor ID numbers to what is recorded in the TPWS ECU. 3) If incorrect, register the correct sensor ID numbers using the Diagnostic Tester.
	TPWS ECU or antenna/receiver malfunction.	Refer to the diagnostic procedure for checking the TPWS ECU and/or antenna/receiver located in the applicable Repair Manual on TIS.
	Transmitters are inoperative.	Replace sensors.


**System  
Concerns &  
Repair Methods**  
(Continued)

COMMON SYMPTOM	CAUSE	REPAIR SUGGESTIONS
<p>One or more tire pressures display “–14 psi-g” &amp; “–40°F” on the Diagnostic Tester Data List.</p> <p><b>Land Cruiser ONLY:</b></p> <p>C2131 C2132 C2133 C2134 C2135 C2177</p>	<p>“MAIN/2nd” switch is in the incorrect position (Land Cruiser ONLY).</p>	<p>Check position of “MAIN/2nd” switch. (“MAIN” for the main set of tires and “2nd” for second set of tire pressure warning valve/sensor ID numbers.)</p>
<p>Tire pressure reads higher than actual vehicle loading label specification.</p>	<p>Initialization is incorrect or incomplete.</p>	<p>Adjust and set tire pressures according to the vehicle loading label specification. (Label is inside the driver’s door jamb.)</p>




**Registration Procedure****Registration of tire pressure warning valve/sensor ID numbers:**


1. Jump TC and CG at DLC3 with the key ON and eEngine OFF for 30 seconds (Land Cruiser — Jump TC and E1 at DLC 1).
2. Register the 7-digit IDs:

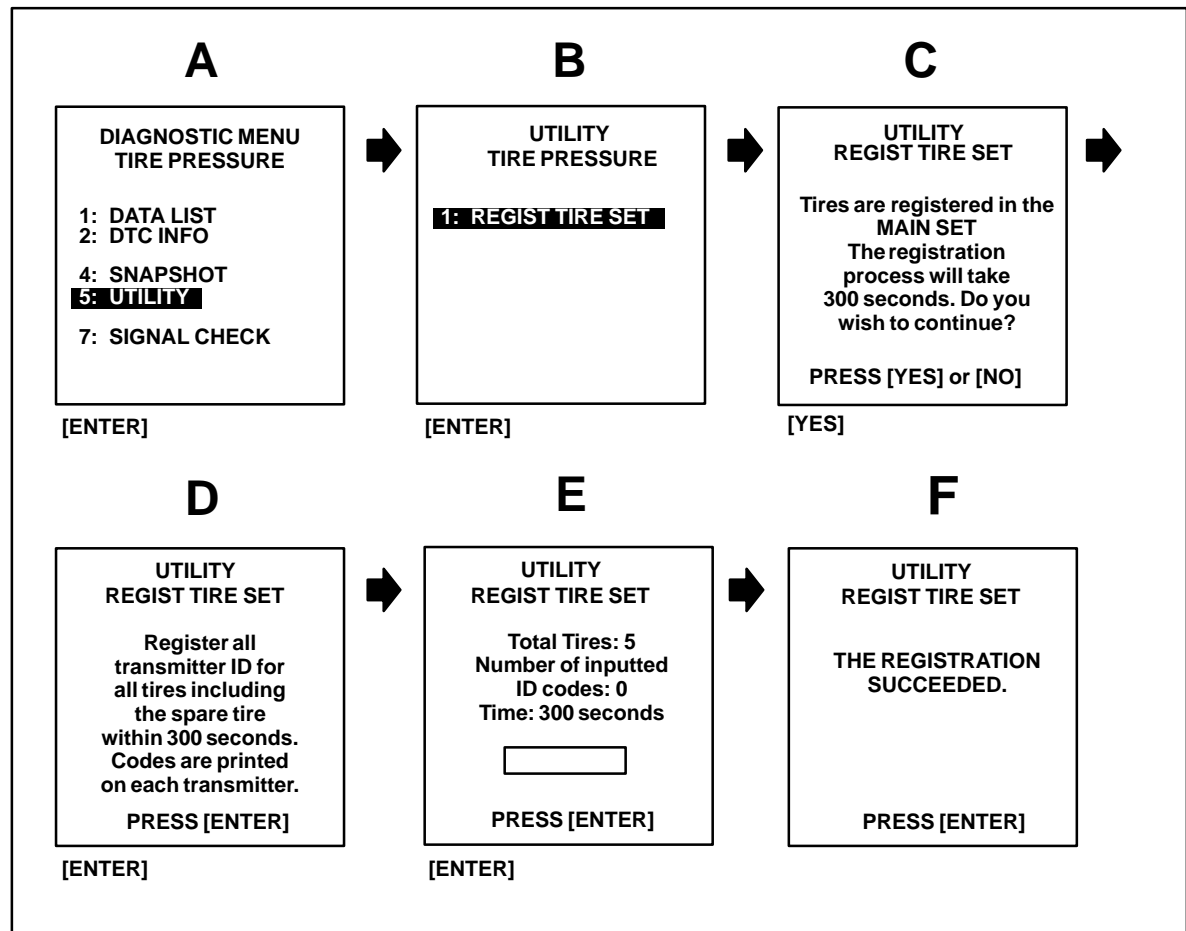

3. Confirm the actual tire pressure to the Diagnostic Tester Data List and set according to the tire inflation pressure indicated on the vehicle loading specification label.
4. Confirm that the Tire Pressure Warning System Indicator Light is OFF.
5. Push and hold the Initialization/"SET" switch (if equipped) until the Low TPWS Light blinks 3 times and then release the switch. Keep the ignition key ON for 5 minutes for the system to initialize.  
The registration is complete.

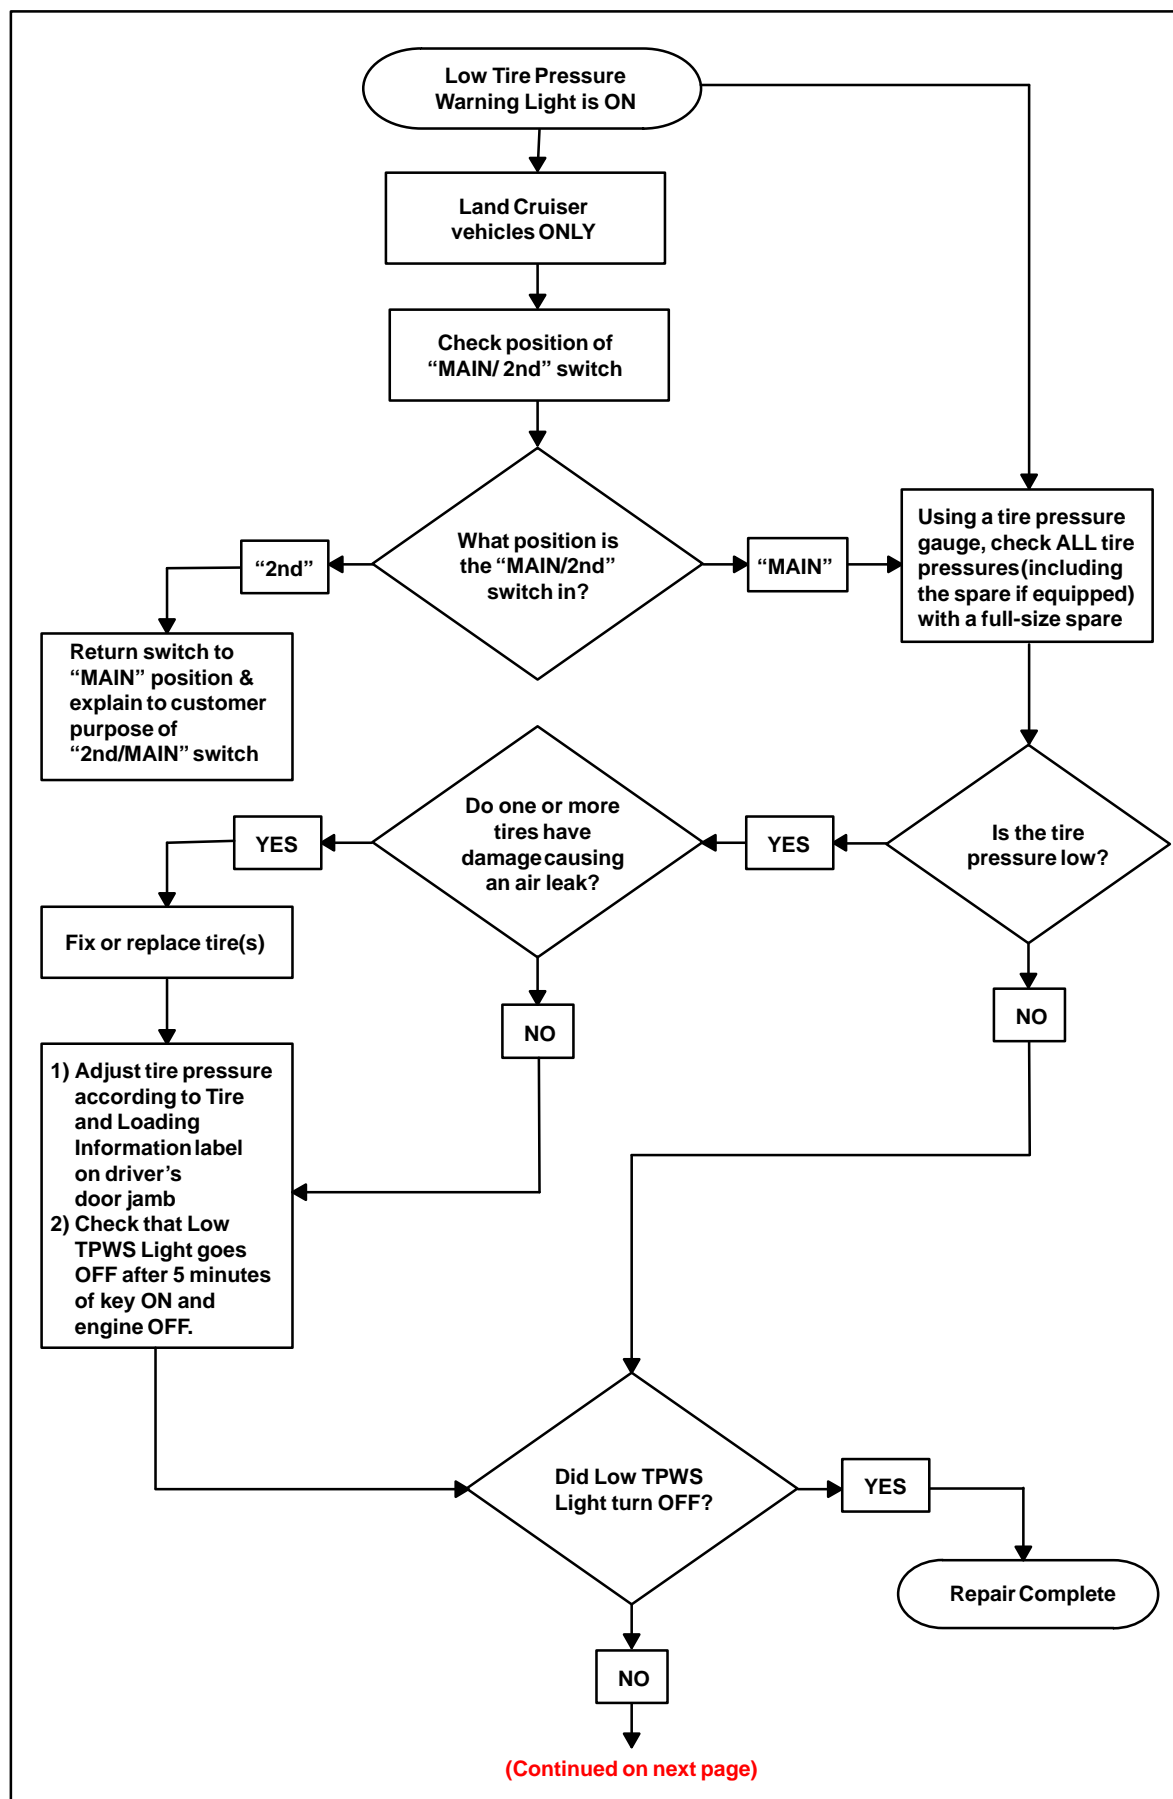Diagnostic  
Flow Chart

**Diagnostic  
Flow Chart**  
(Continued)

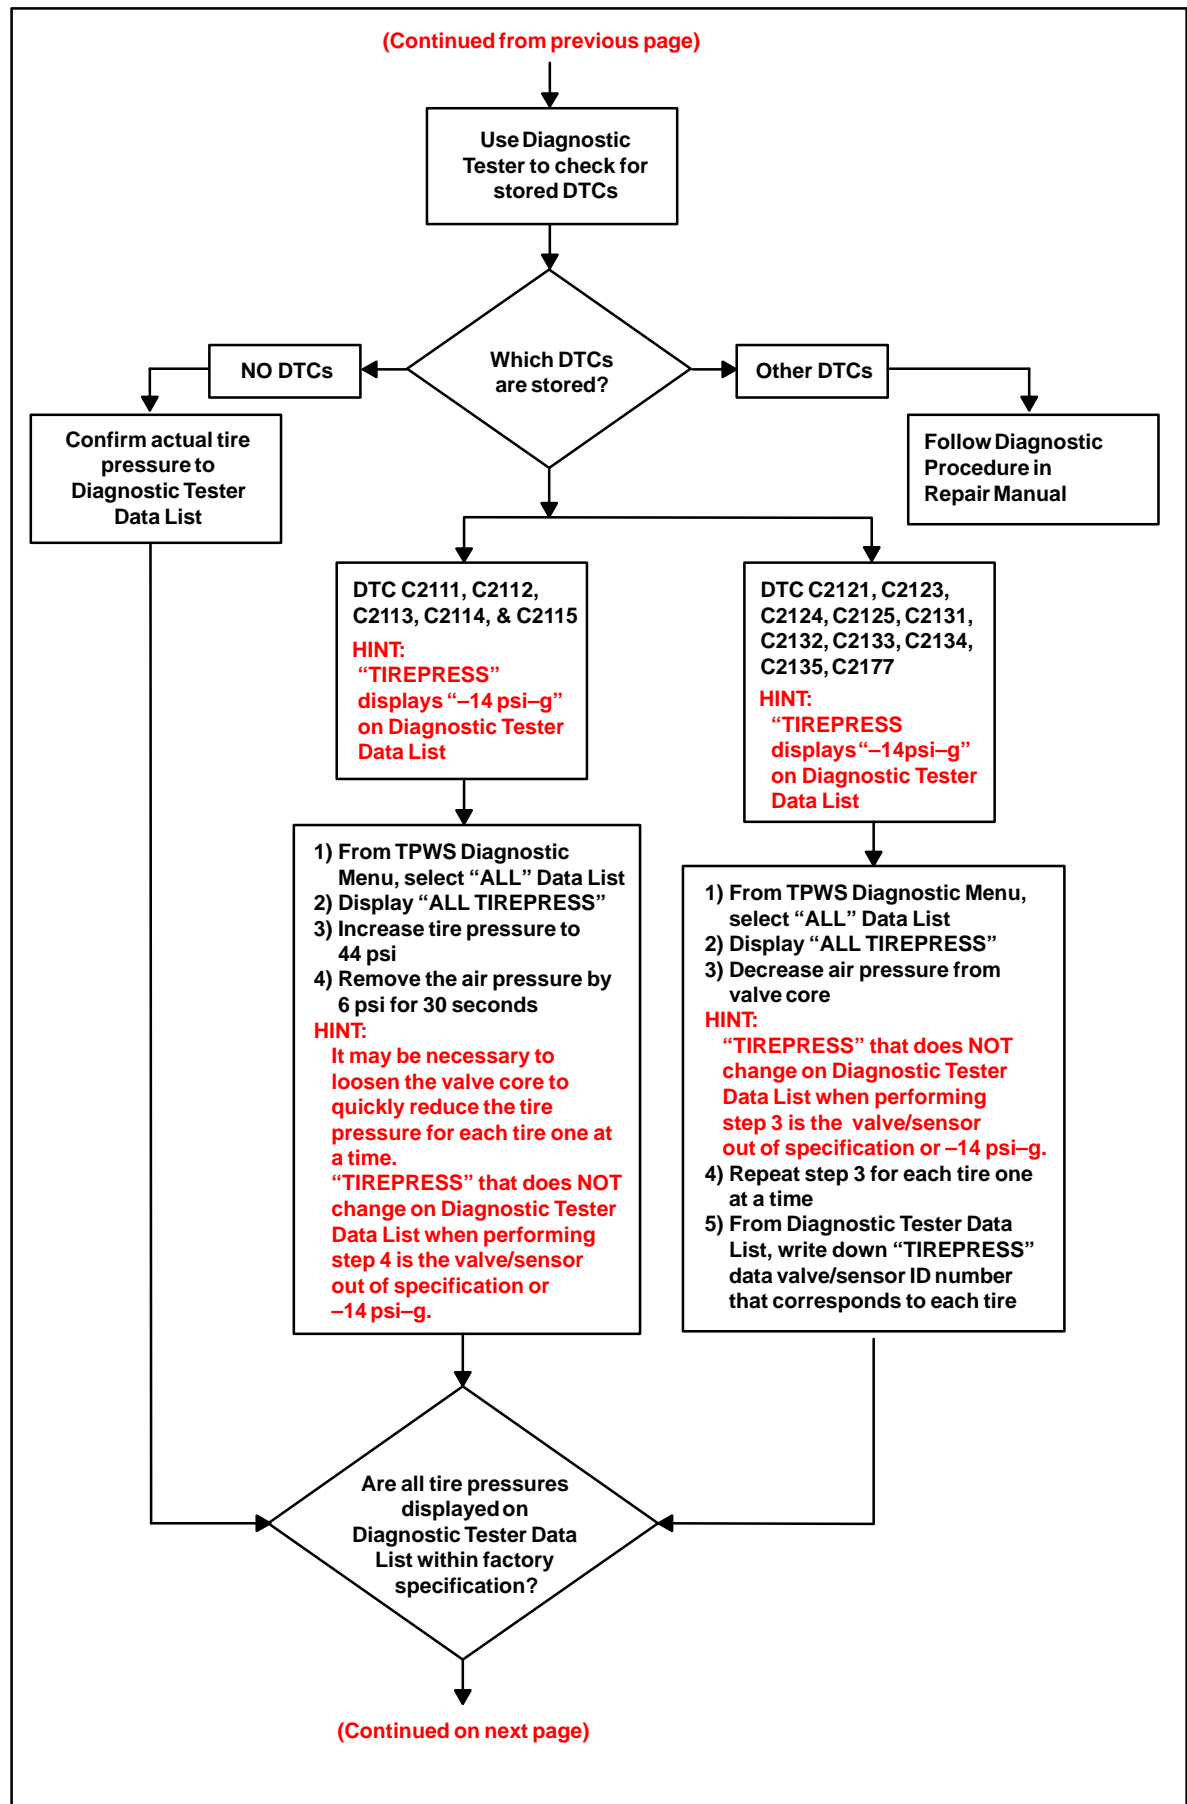

**Diagnostic  
Flow Chart**  
(Continued)