



## Technical Service BULLETIN

August 25, 2004

Title:

**M.I.L. "ON" DTC P0031 AND/OR P2238**

Models:

**'04 RAV4**

ENGINE  
EG036-04

**Introduction** Under certain driving conditions, some 2004 model year RAV4 vehicles may exhibit a M.I.L. "ON" condition with one or both of the following DTC's.

- P0031 - Oxygen (A/F) Sensor Heater Control Circuit Low (Bank 1 Sensor 1)
- P2238 - Oxygen Sensor Pumping Current Circuit Low (For A/F Sensor) (Bank 1 Sensor 1)

The A/F sensor manufacturing process and the Engine Control Module (ECM) (SAE term: Powertrain Control Module/PCM) logic have been modified to improve these conditions.

**CAUTION:**

Version 11.0a or later Diagnostic Tester software is required.

**Applicable  
Vehicles**

- All 2004 model year **RAV4** vehicles.

**Parts  
Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
89467-42040	Same	Sensor, Air Fuel Ratio	1
N/A	00451-00001-LBL	Authorized Modifications Label	1

**NOTE:**

Authorized Modification Labels may be ordered in packages of 25 from the Materials Distribution Center (MDC) through Dealer Daily Dealer Support Materials System, or by calling the MDC at 1-800-622-2033.

**Warranty  
Information**

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
EG4013	Recalibrate ECM (PCM) Engine and R & R A/F Sensor	1.3	89661-42A60 89661-42A70 89661-42A81 89661-42A91 89661-42B00	8A	99



**Applicable Warranty\*:**

This repair is covered under the Toyota Specified Major Emission Control Component Warranty. This warranty is in effect for 96 months or 80,000 miles, whichever occurs first, from the vehicle's in-service date.

\* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



**Required  
SSTs**

SPECIAL SERVICE TOOLS (SSTs)		PART NUMBER	QUANTITY
Toyota Diagnostic Tester Kit*		01001271	1
12 Megabyte Diagnostic Tester Program Card with version 11.0a Software (or later)*		01002593-005	1

\* Essential SSTs.

**NOTE:**

**Additional Diagnostic Tester Kits, Program Cards or other SSTs may be ordered by calling SPX/OTC at 1-800-933-8335.**

**Calibration  
Information**


MODEL	VDS	CURRENT CALIBRATION ID	NEW CALIBRATION ID
2WD MT	GD20V	34234000	34234100
2WD AT		34236000 34236100	34236200
4WD MT	HD20V	34235000	34235100
4WD AT		34237000 34237100	34237200

**Repair  
Procedure****For DTC P0031 and/or P2238:**

1. Replace Bank 1 Sensor 1 A/F Sensor.
2. Perform ECM (PCM) recalibration (see Calibration Procedure) with New Calibration ID as shown above in Calibration Information table.


**Calibration  
Procedure****Verify Vehicle Condition**

1. Check for the Authorized Modifications Label affixed to the vehicle in the location shown in Figure 1. Confirm if ECM (PCM) calibration has been updated. If not the latest ECM (PCM) calibration - **go to step 2.**

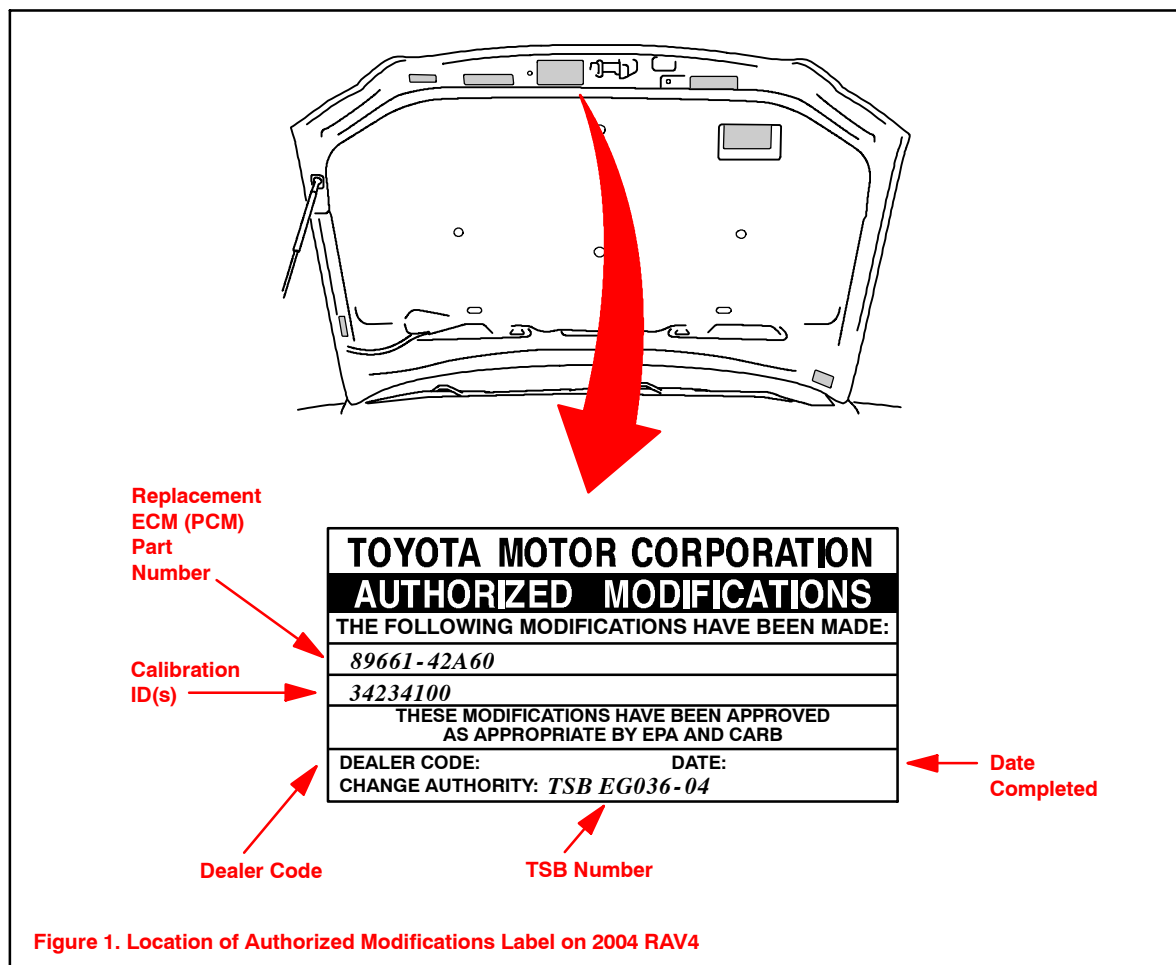

**Calibration Procedure**  
(Continued)

2. Connect the Diagnostic Tester to the vehicle's DLC3 connector and select CURRENT ECU CAL from the ECU REPROGRAM MAIN MENU. Determine the vehicle's current ECU calibration (see Figure 2).

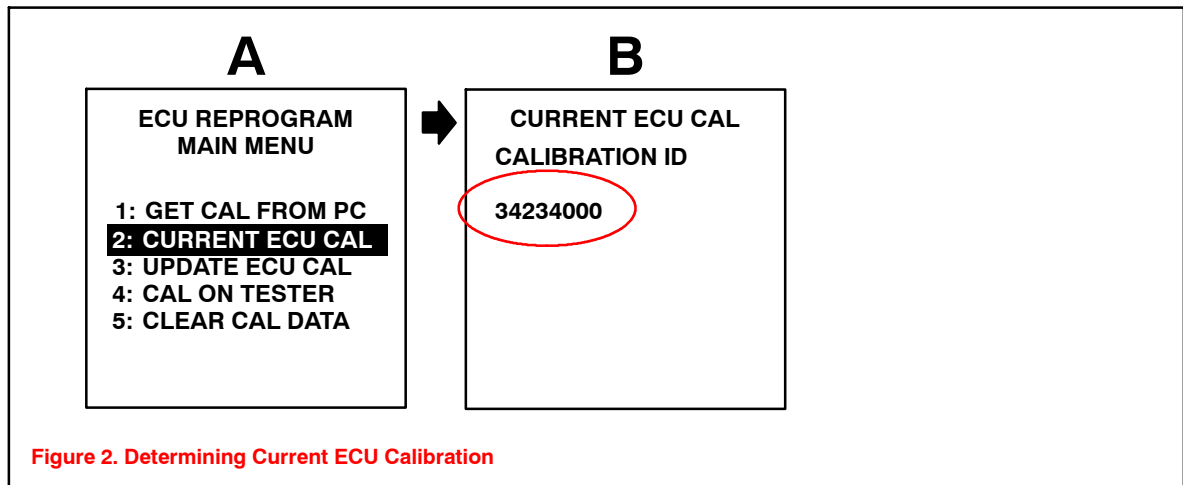**NOTE:**

- If Calibration ID matches "Current Calibration ID" as shown on page 2, proceed with flash reprogramming.
- If Calibration ID matches "New Calibration ID" as shown on page 2, this vehicle has already been reprogrammed. Refer to Repair Manual or TIS for diagnosis.

3. If ECU calibration ID is not the same as the "New Calibration ID" listed previously, proceed to Flash Reprogram ECM (PCM).

**Flash Reprogram ECM (PCM)**

1. Follow the procedures outlined in TSB No. SS002-01, "ECU Flash Reprogramming Process," and flash the ECM (PCM) with new calibration file update.
2. Enter the required information on the Authorized Modifications Label and affix it to the vehicle at the location shown in Figure 1 (page 3). The Authorized Modifications Label is available through the MDC, P/N 00451-00001-LBL.
3. Calibration update is complete.