

TECHNICAL SERVICE BULLETIN

Ref.: ENGINE

No.: EG003-96


Date: OCTOBER 11, 1996

Model: ALL MODELS

Title: UNDERCOATING ON OXYGEN SENSORS

Page 1 of 1

During vehicle processing by Dealers, care must be taken to avoid applying undercoating in the area surrounding the Oxygen Sensors. Application of undercoating on or near the Oxygen Sensors can cause insufficient air to flow around the sensor, and inaccurate information storage by the ECM. If this condition occurs, the Malfunction Indicator Light (MIL) may illuminate.

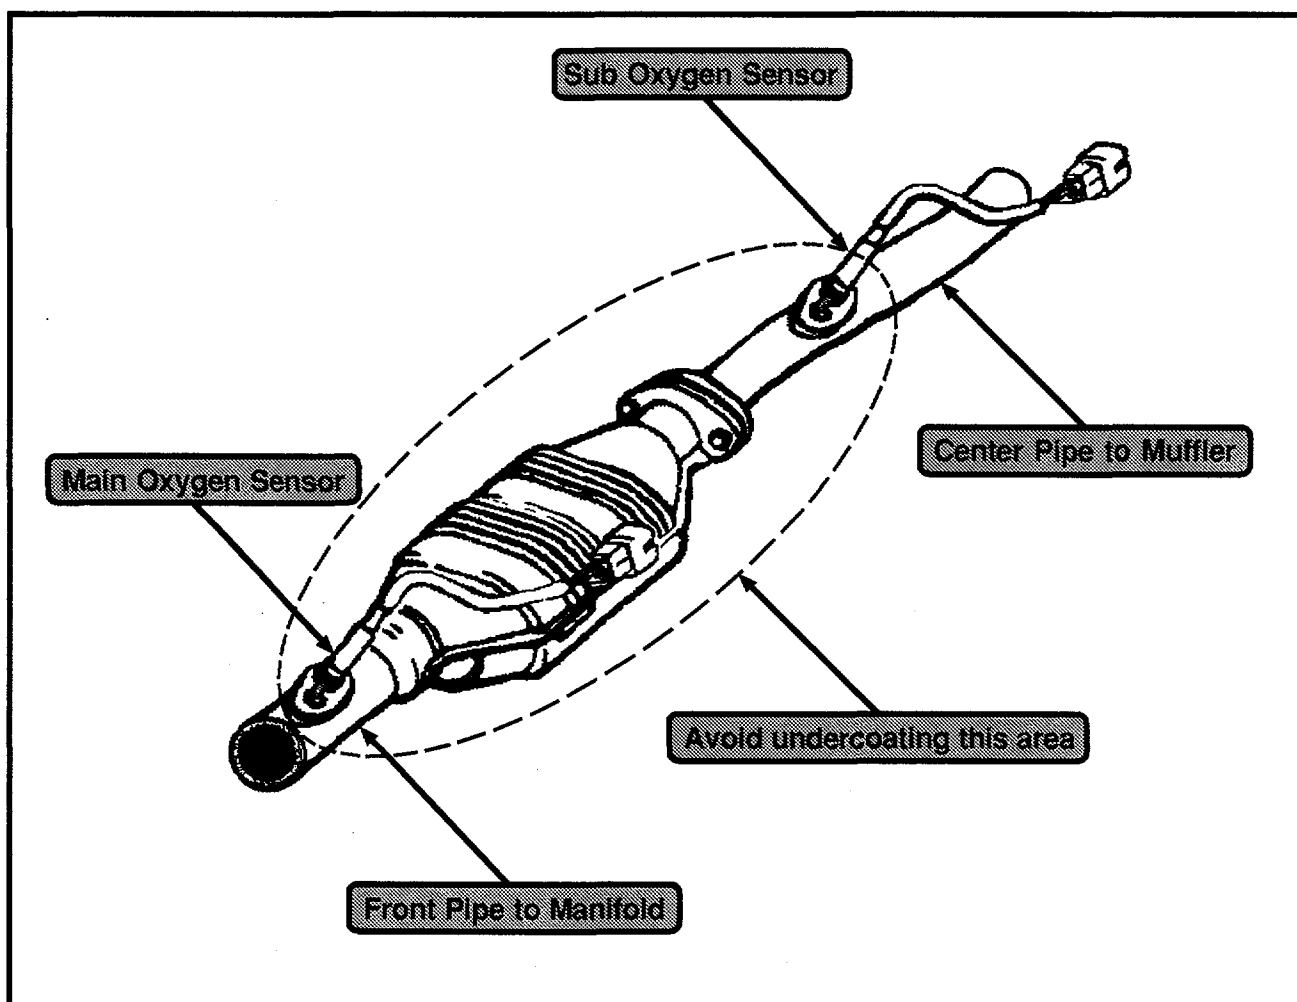

Index # **045757**