


# RADIO RECEIVER ASSY REPLACEMENT


6705V-01

1. REMOVE INSTRUMENT CLUSTER FINISH PANEL SUB-ASSY CENTER  
(See page 71-10)
2. REMOVE INSTRUMENT CLUSTER FINISH PANEL END  
(See page 71-10)
3. REMOVE AIR CONDITIONING CONTROL ASSY  
(See page 55-37)

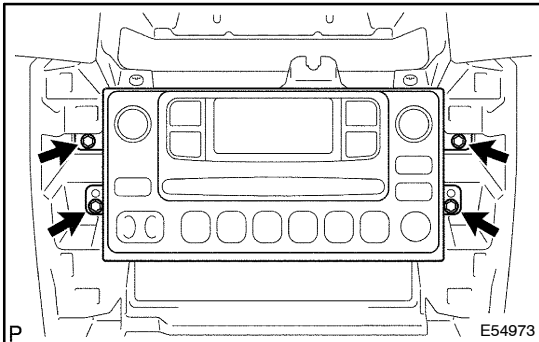


## 4. REMOVE RADIO RECEIVER ASSY

- (a) Remove the 4 screws.
- (b) Disconnect the connectors and remove the radio receiver assy.

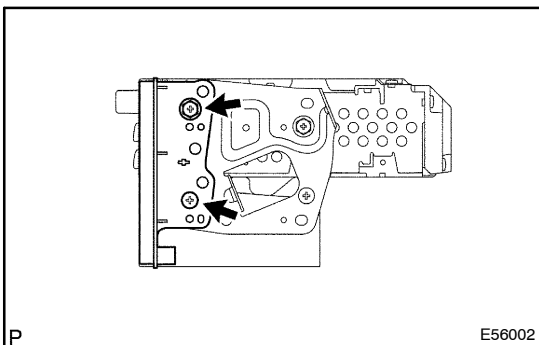

## 5. REMOVE RADIO RECEIVER PANEL

- (a) Remove the 2 screws and radio receiver panel.

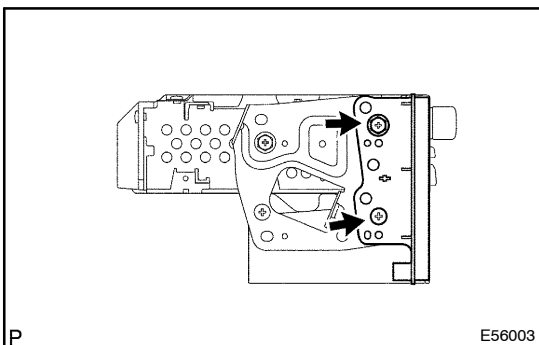


## 6. RADIO RECEIVER PANEL

- (a) Remove the 2 screws and radio receiver panel.

**7. REMOVE RADIO BRACKET NO.1**

- (a) Remove the 2 screws and radio bracket No.1. (w/ stereo opening cover)
- (b) remove the 4 screws and radio bracket No.1. (w/ stereo opening cover)

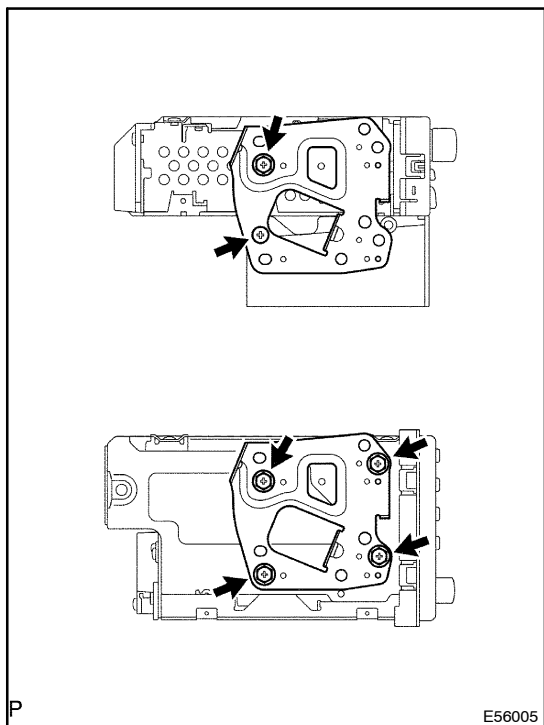**8. REMOVE RADIO BRACKET NO.2**

- (a) Remove the 2 screws and radio bracket No.1. (w/ stereo opening cover)
- (b) Remove the 4 screws and radio bracket No.1. (w/ stereo opening cover)

