

APR 02 2002

Title:
WIND WHISTLE FROM FRONT EDGE
OF HOOD
Models:
'02 RAV4

SB629481

YID

NV004-02

NVH

Introduction Some customers may experience a high-pitched wind whistle from the leading edge of the hood at highway speeds. The following field fix procedure is recommended to improve this condition.

- Applicable Vehicles**
- **2002** model year **RAV4** vehicles produced before the VINs shown below.

Production Change Information

MODEL	STARTING VIN
RAV4 4WD	JTEHH20V220149012
	JTEHH20V826034590
RAV4 2WD	JTEGH20V920057844
	JTEGH20V626000000

Parts Information

PART NUMBER	PART NAME
08231-00810	Wind Noise Kit

Warranty Information

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
BD1038	R & R Hood to Radiator Grille Seal	0.3	53395-42010	59	43

Applicable Warranty*:

This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.




Toyota Supports ASE Certification


629481

**Repair
Procedure**

1. Remove the hood to radiator grille seal from the hood.

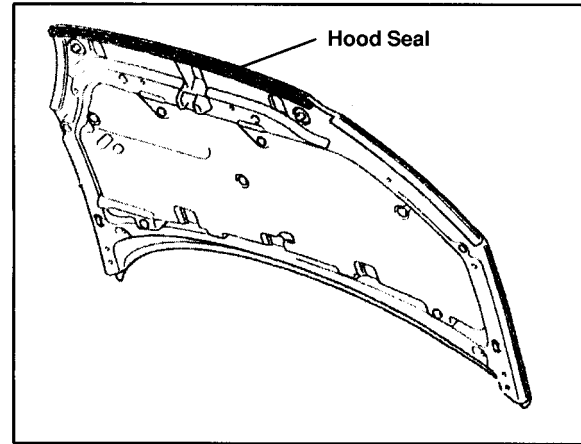

2. Cut two pieces of EPT sealer from the wind noise kit, and apply them to the hood seal as shown.

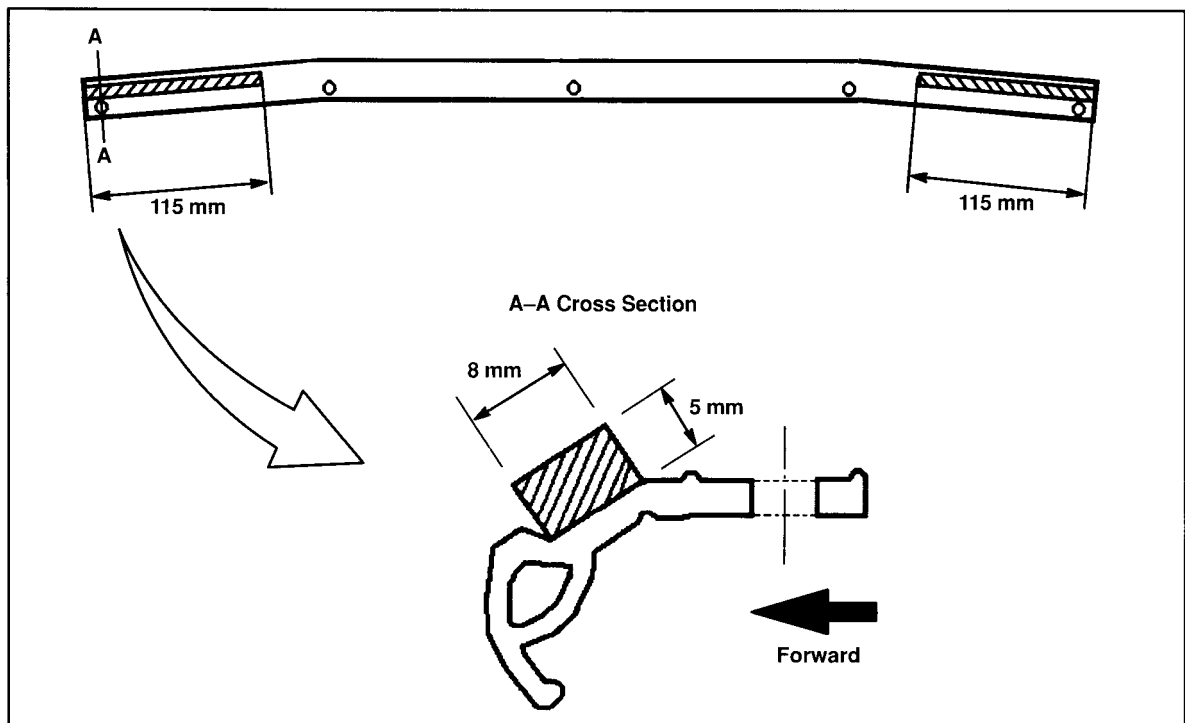EPT Size**Length: 115 mm****Width: 8 mm****Thickness: 5 mm**

3. Reinstall the hood seal.