



Technical Service BULLETIN

February 8, 2002

Title:


IMPROVEMENT TO REAR WIPER WASHER NOZZLE

Models:

'00 – '01 RAV4

BODY
B0004-02

Introduction The rear wiper washer nozzle has been changed from a one-hole type to a two-hole type for improved washing performance.

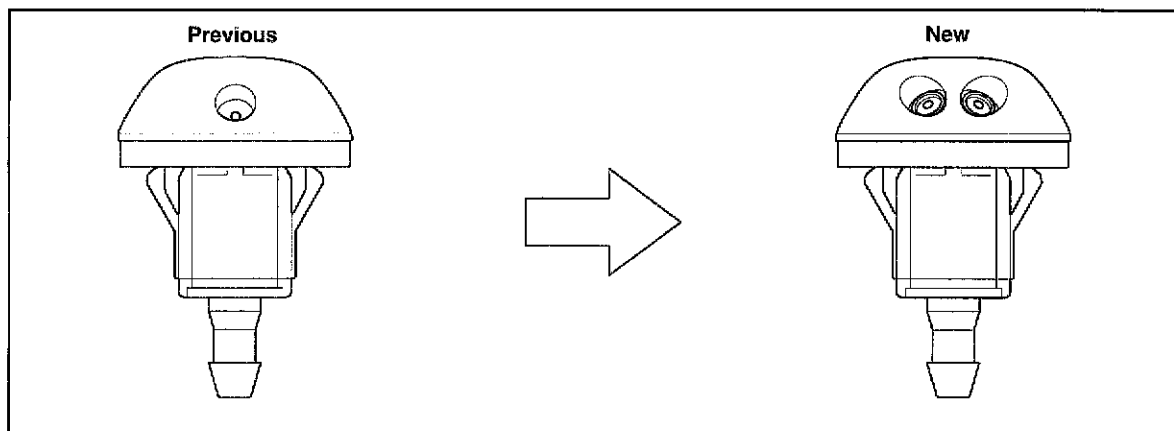

Applicable Vehicles

- 2000 – 2001 model year RAV4 vehicles.

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME
85385-42020	85395-42020	Nozzle Sub-Assembly, Rear Washer

Warranty Information

OP CODE	DESCRIPTION	TIME	OPN	T1	T2
BD1033	R & R Nozzle Sub-Assembly	0.3	85385-42020	75	55

Applicable Warranty*:

This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.




Toyota Supports ASE Certification


050636

**Replacement
Procedure**


1. Remove the interior Center High Mounted Stop Lamp (CHMSL) cover using a nylon pry-tool or a flat head screwdriver protected with tape.

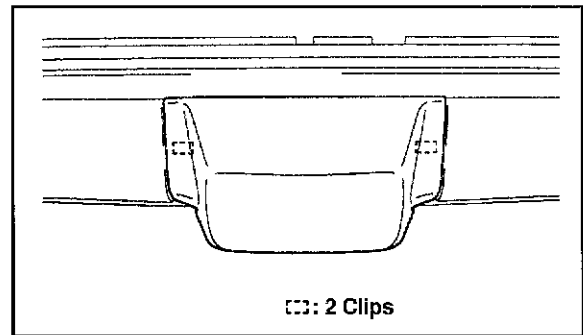

2. Remove the grommet surrounding the washer tube as it enters the rear door.

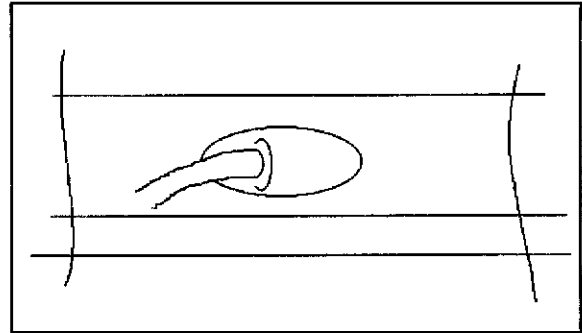

3. Remove the original washer nozzle by depressing the lock tabs with a screwdriver.

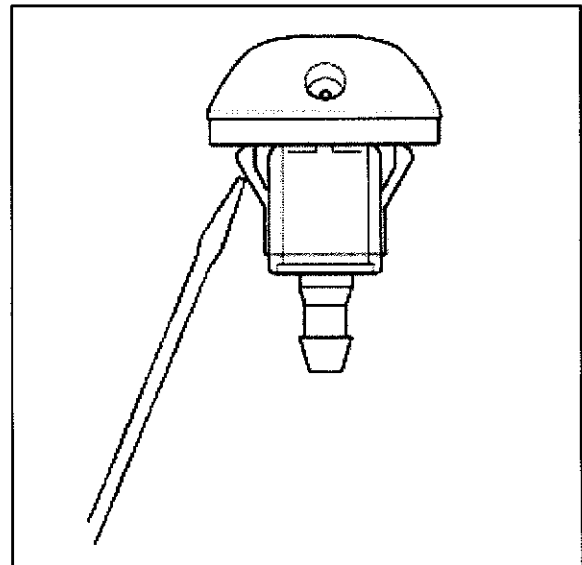

4. Reassemble with the new washer nozzle.